



G00018950

Fig. 3: Removing Front Bumper Cover (From October, 2000)
Courtesy of VOLKSWAGEN UNITED STATES, INC.

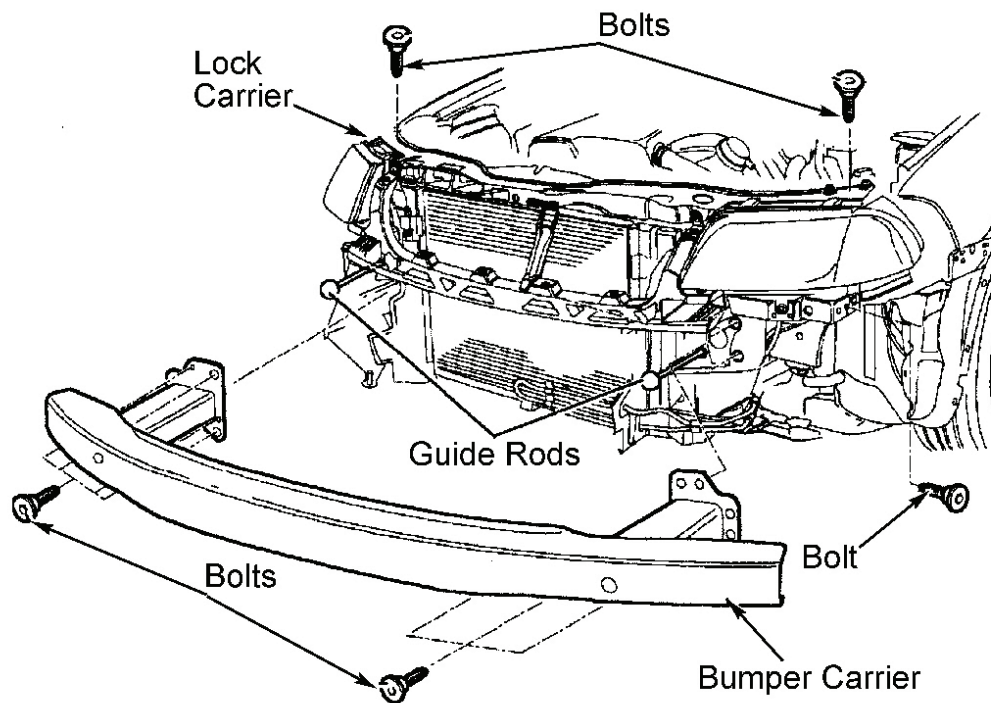


G00018951

Fig. 4: Moving Lock Carrier To Service Position (From October, 2000)
Courtesy of VOLKSWAGEN UNITED STATES, INC.

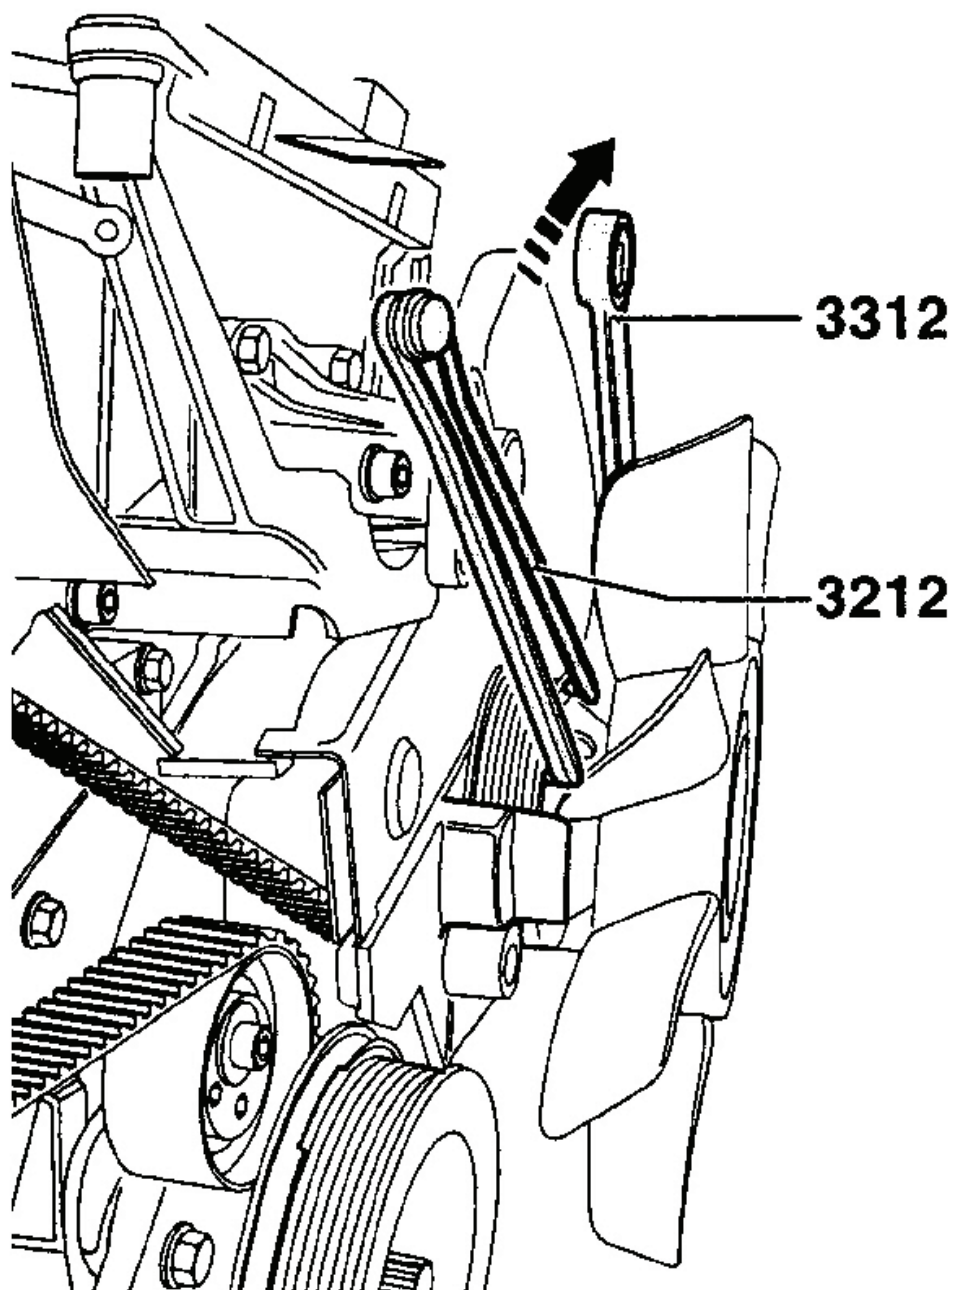

G00155233

Fig. 5: Removing & Installing Viscous Fan
Courtesy of VOLKSWAGEN UNITED STATES, INC.

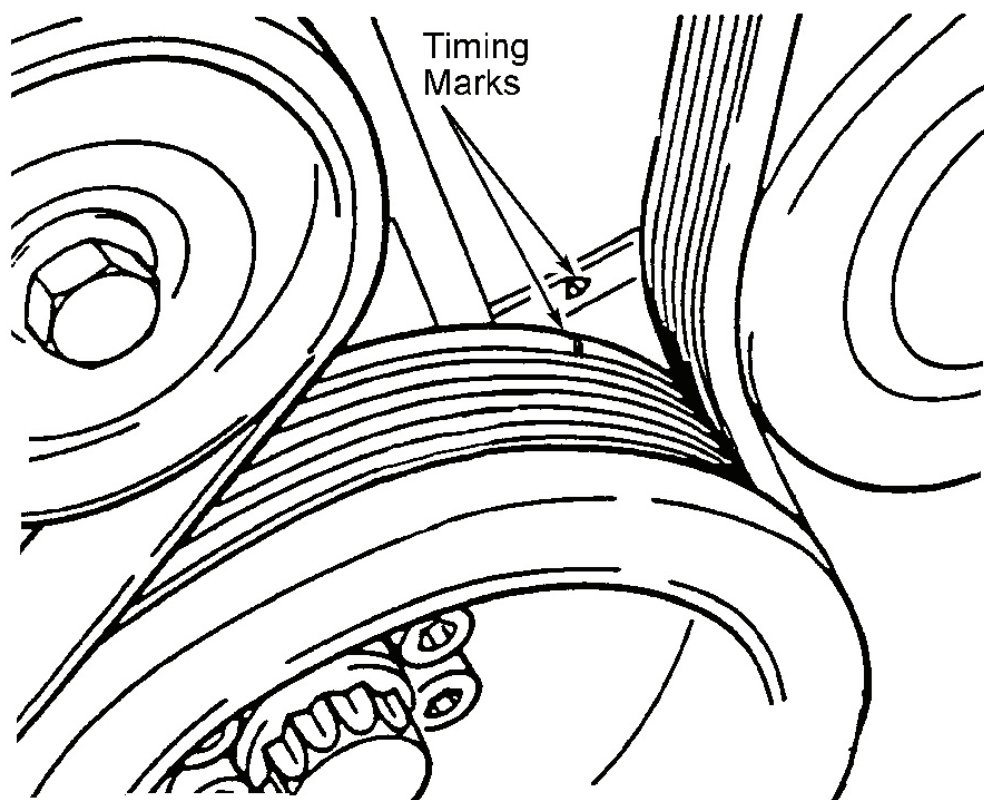

G93B82819

Fig. 6: Aligning Crankshaft Timing Marks
Courtesy of AUDI OF AMERICA, INC.