


Fig. 1: Removing Clockspring From Steering Column
FORD MOTOR CO.
1995 Ford Explorer

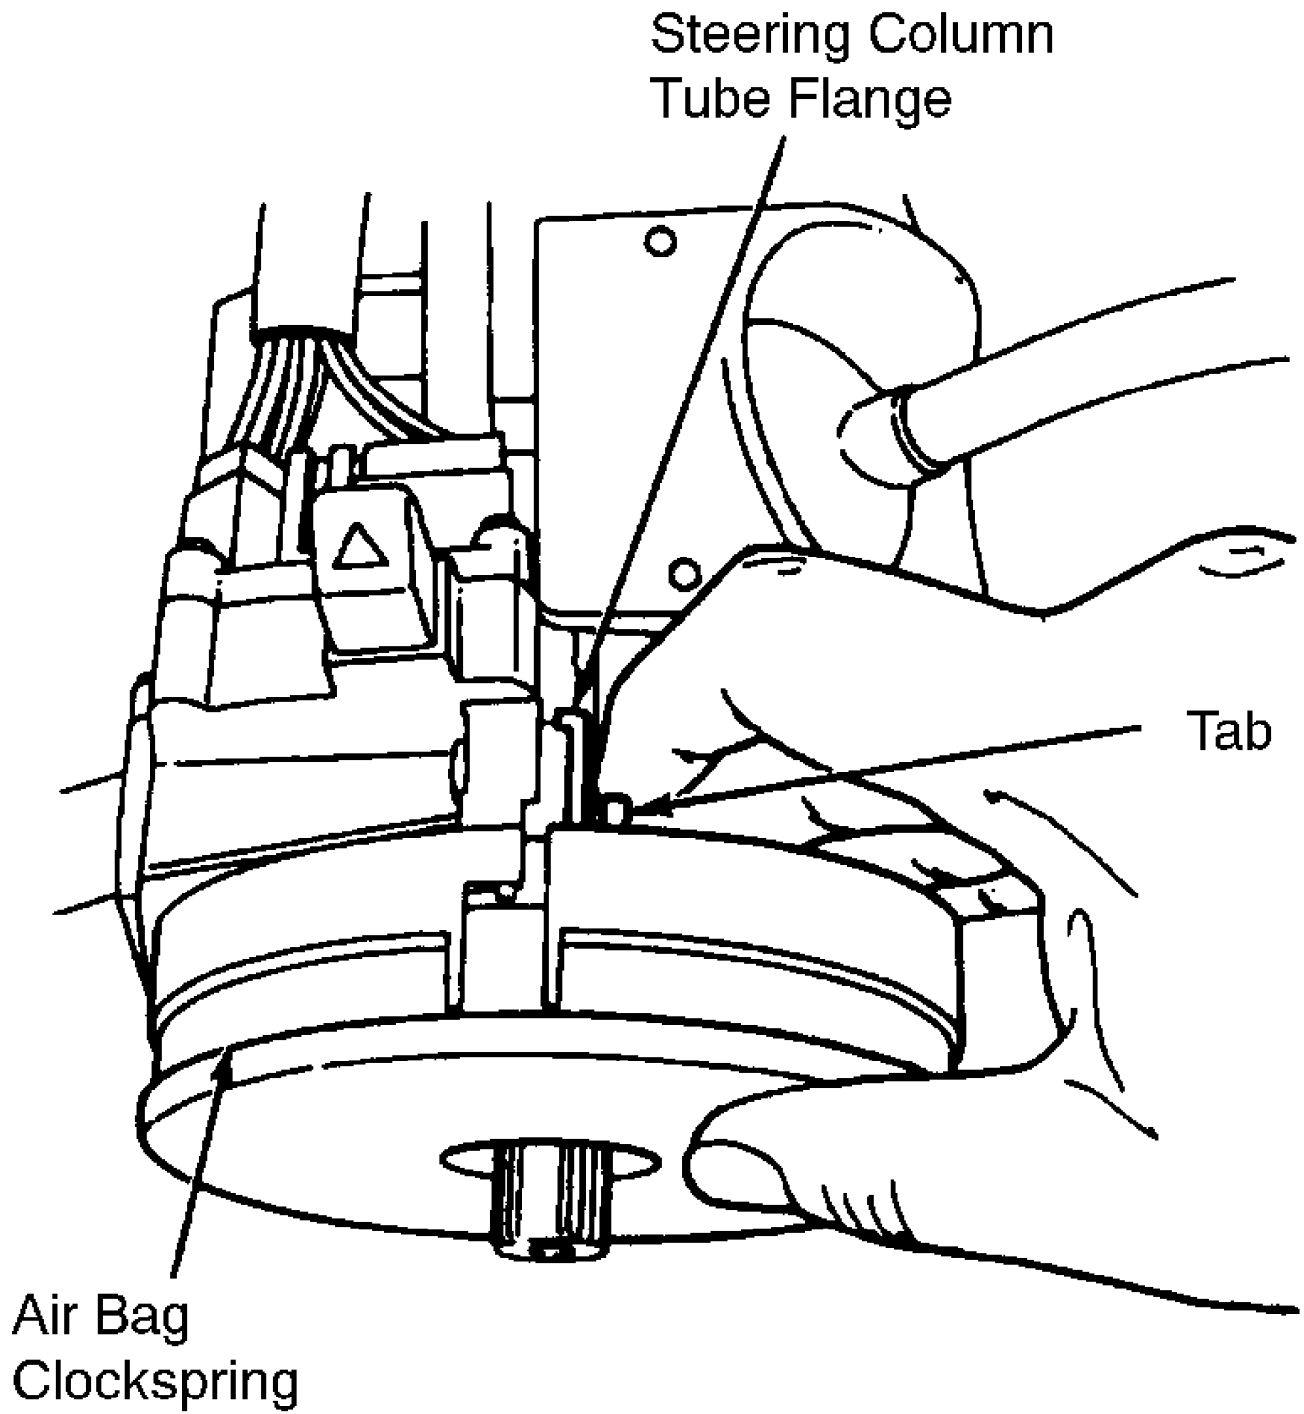

95B26105